Approved For Release 2000/06/01: CIA-RDP89B00569R000900190004-2

0410Z 27 DEC 1962

SECRET

25X1A DIRECTOR

OPERATIONAL IMPEDIATI

OPS (1-2-3-4-5)

S/C (6)

TOR: 9424Z 27 DEC 1962

25X1A

IN-60421

25X1A

- 1. ON GRC-134 AND GRC-135 BOTH HIGH AND LOW PRF LIGHTS OF
  SYSTEM XII HAVE COME ON AND REMAINED ON AS SOON AS SYSTEM WAS
  TURNED ON. NO AUDIO SIGNALS WERE PRESENT ON EITHER MISSION. WHEN
  AC POWER WAS TURNED OFF LIGHTS APPEARED TO WORK NORMALLY.
  TROUBLE HAS BEEN DIAGNOSED AS BRUSH NOISE FROM THE AC ALTERNATOR.
- 2. IN AN EFFORT TO RESTORE OPERATIONAL CAPABILITY ASAP WE ARE
  TRANSPOSING TWO LEADS TO SYSTEM XII POWER SENSING RELAY. THIS
  WILL MAKE THE INVERTOR THE PRIME SOURCE OF POWER FOR SYSTEM XII, WITH
  ALTERNATOR AS SECONDARY SOURCE, IN CASE OF INVERTOR
  FAILURE. NO TROUBLE WITH THE PRF LIGHTS HAS BEEN ENCOUNTERED
  WHILE OPERATING OFF INVERTOR POWER.
- 3. IF ANY OBJECTIONS PLEASE NOTIFY SOONEST, AS WE EXPECT TO COMPLETE THIS CHANGE AND HAVE ARTICLE OPERATIONAL READY THIS AFTERNOON.

  END OF MESSAGE